
CITY OF BALTIMORE WET W SMOKE AND DYED W	Page 1 of 4	
Sewershed: JONES FALLS	Company: REI/DRAYCO	Date: 06/12/08
Test to be Performed: SMOKE	Ground Condition: DRY	Supervisor: ER
Manhole ID: S37MM_038MH	Test ID: 0994-333	Notifications Made:_X (Residents, Fire, 311)

Field Sketch: (Show All Manholes with Numbers, Blower Placement Location, Sandbag or Isolation Locations, Street Names, Building Addresses and Locations, Defect Locations and Photograph Numbers)

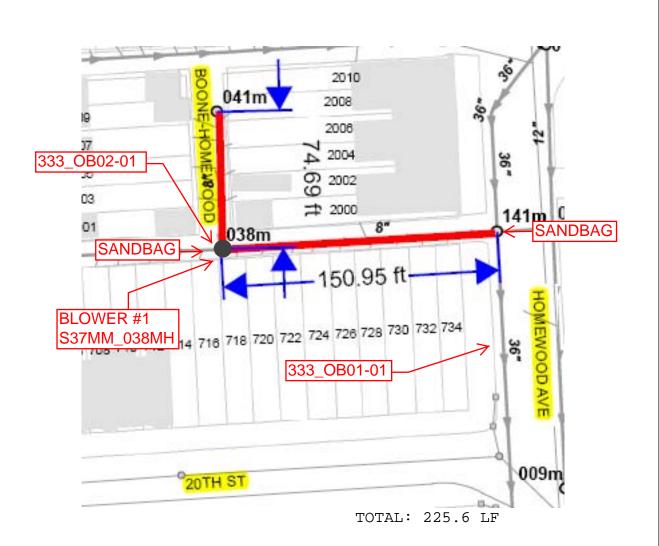

CITY OF BALTIMORE WET WEA SMOKE AND DYED WATI							Page 2 of 4		
Sewershed: JONES FALLS			Company: REI/DRAYCO				Date: 06/12/2008		
Test to	be Performed:			Ground	Condition	:		Supervisor:E.R	
Smoke:X Dyed Water:				Dry: _X Damp: Wet:			- s.p		
OnlokeA Dyeu Water			BryX Bamp wet				Notificatio	ns Made: X	
Manhole ID: S37MM_038MH			Test ID: 0994-333				(Residents, Fire, 311)		
	Sketch: (Showons, Street Nam							•	
Defect				Source			Drainage		,
No.		Address		Туре	Location	Sector	Area	Severity	Photo Number
	734 E. 20TH S	Г.		16	12	01	1	03	333-OB01-01
2	S37MM 038MI			01	01	01	20	02	333-OB02-01
	007 WIWI_000WII	<u> </u>		01	01	01	20	02	000 0002 01
				OBSERV	ATION_	CODES			
	Source Type	Location	Sector	Severity		Source Type	Location		
01	Main Sewer	Paved Concrete	Public	No Smoke	10	MH Frame S	Non-Paved		
02	Service Line	Paved Asphalt	Private	Trace	11	Storm Drain	Field/Woods		
03	Cleanout	Paved Other		Moderate	12	Catch Basin	Alley		
04	Downspout	Driveway		Major	13	Storm Manh	Golf Course		
05	Area Drain	Sidewalk			14	Storm Ditch	Other		
06	Driveway Drain	Curb			15	Excavation			
07	Stairwell Drain	Yard- Front			16	Other			
08	Foundation Drain	Yard-Back							
09	Building Interior	Yard- Side							

PAGE 3 OF 4

CITY OF BALTIMORE SMOKE TESTING OBSERVATION SUMMARY JONES FALLS SEWERSHED

BALTIMORE CITY PROJECT 994 REI/DRAYCO

Unique Test ID: 333	Date: 06/12/2008	Basin: JF-19
Defect No: 01	Supervisor: E.R.	Dye Test Recommended: N
House No: 734	Street Name: E. 20TH	Street Type: ST.
Source Type: 16	Location: 14	Severity: 03
Sector: 01	Drainage Area: 1	

Comments: SMOKE EMINATING NEAR FENCE, UNKNOWN SOURCE TYPE

SMOKE TEST PHOTOGRAPHS



Photograph No: OB01-01 Filename: 0994-333_OB01-01.jpg

PAGE 4 OF 4

CITY OF BALTIMORE SMOKE TESTING OBSERVATION SUMMARY JONES FALLS SEWERSHED

BALTIMORE CITY PROJECT 994 REI/DRAYCO

Unique Test ID: 333 Date: 06/12/2008 Basin: JF-19

Defect No: 02 Supervisor: E.R. Dye Test Recommended: N

Location: S37MH_038MH

Source Type: 01 Location: 12 Severity: 02

Sector: 01 Drainage Area: 10

Comments: SMOKE EMINATING FROM CRACKS, 10 FT UPSTREAM OF S37MM_038MH

SMOKE TEST PHOTOGRAPHS



Photograph No: OB02-01 Filename: 0994-333_OB02-01.jpg